

DETAIL VIEWS AND CLEARANCE REQUIRED BELOW DOOR. STEP 2

LOCATE AND DRILL 21/64"Ø HOLES FOR BOLTS USING THE DIMENSIONS SHOWN IN ILLUSTRATION. NOTE: IF USING CAS-2 DOOR STOP ADD 2" TO DIMENSION FROM EDGE OF DOOR.

STEP 3


PREPARE DOOR FOR INSTALLATION OF OPTIONAL PRODUCTS IF PURCHASED SUCH AS GUIDE CHANNELS, CUP PULLS, DOOR LOCKS, ETC. INDIVIDUAL INSTRUCTIONS ARE PROVIDED WITH THE RESPECTIVE PRODUCT. STEP 4

PLACE HANGER ASSEMBLY ON DOOR AND SECURE CLAMPS TO DOOR WITH 5/16"-18 HEX BOLTS(2), 5/16" WASHERS(2), AND 5/16" HEX NUTS(2). STEP 5

PLACE DOOR AND HANGERS INTO C-104 OR C-108 TRACK AND SECURE TO HEADER. ALTERNATE: IF TRACK ENDS ARE NOT ACCESSIBLE AFTER MOUNTING: AFTER PREPARING DOOR FOR HANGERS, INSTALL HANGERS IN TRACK AND MOUNT TRACK. RAISE DOOR INTO POSITION BELOW HANGERS & BOLT THROUGH PREDRILLED HOLES.


STEP 6

AND PLUMB WITH 1/2" WRENCH ON HEX NUT OF CENTER BOLT.





K.N. CROWDER MFG. INC. 1220 BURLOAK DRIVE BURLINGTON, ONTARIO, CANADA, L7L 6B3 TELEPHONE: 905-315-9788 - FAX: 905-315-8090 TOLL FREE FAX: 1-800-567-0123

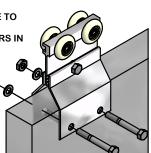

2-1/8"

[54 mm]

1-7/16

[36 5 mm]

3' [76.2 mm]

K.N. CROWDER INC. 210 FIGHTH STREET SOUTH LEWISTON, NEW YORK, U.S.A. 14092 TOLL FREE TELEPHONE: 1-866-999-1KNC (1562) TOLL FREE FAX: 1-800-567-0123

WEBSITE: www.kncrowder.com --- E-MAIL: customerservice@kncrowder.com